


125 EUGENE O'NEILL DRIVE NEW LONDON, CT 06320 TEL: 860-445-3800

TEL: 860-445-3800 FAX: 860-405-2990


STEP 2:


# HIGH DENSITY JACK INSTRUCTION SHEET

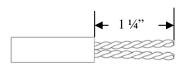


STEP 1: STRIP 1-1/4" OF CABLE JACKET OFF STATION CABLES. TRIM SPLINE FLUSH.



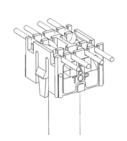


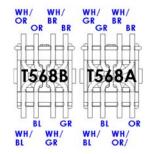

STEP 3: SEAT THE WIRES INTO THE APPROPRIATE SLOTS

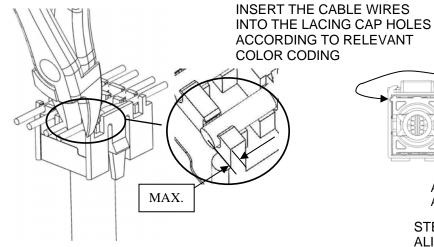


STEP 4: TRIM EXCESS WIRES FLUSH WITH EDGE OF LACING CAP. (MAX.OF .020". FROM THE EDGE OF THE LACING CAP.)

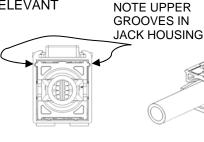


ALIGN "TOP" ON BOTH SLIDE LOCK AND LACING CAP LABEL

STEP 5: ALIGN LACING CAP TO THE JACK BODY AND SEAT BOTH PARTS TOGETHER. MAKE SURE TABS ON LACING CAP ALIGN WITH THE HOUSING GROOVES.

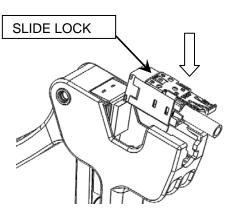


STEP 6: INSERT ASSEMBLED JACK INTO TERMINATION TOOL WITH SLIDE LOCK ON JACK AS SHOWN.

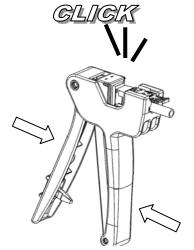

STEP 7: SQUEEZE HANDLES TOGETHER. AN AUDIBLE CLICK SHOULD BE HEARD WHEN THE JACK IS TERMINATED.

### DISASSEMBLY INSTRUCTIONS

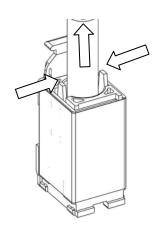

SQUEEZE LACING CAP TABS IN TOWARDS THE CABLE, PULL CABLE AND LACING CAP.


INSTRUCTION SHEET #	REV.	ECN#	SHEET	DWN. BY:	DATE	CHK. BY:	DATE	APP. BY:	DATE
71601781	01	04216	1 OF 2	RWS	08/15/11	G.L.	01/26/12	W. DIETZ	01/26/12




125 EUGENE O'NEILL DRIVE NEW LONDON, CT 06320 TEL: 860-445-3800

FAX: 860-405-2990


HIGH DENSITY JACK TERMINATION AND INSTALLATION INSTRUCTION SHEET

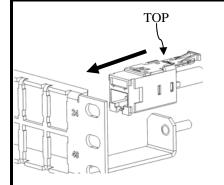

#### PANEL INSTALLATION

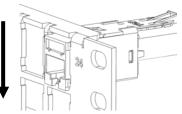

STEP 3: PUSH ON SLIDE LOCK UNTIL THE INTO CONTACT WITH BACKSIDE FRONT IS FLUSH WITH THE JACK **FACE** 

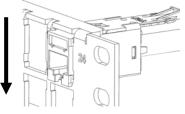

STEP 2:


DOWNWARD.

#### STEP 1: INSERT HD JACK (PULL SLIDE LOCK ALL THE WAY BACK AND ON TOP) FROM REAR SIDE OF PANEL (JACK WILL GO IN ONLY ONE WAY WITH SLIDE LOCK UP.


## **FACEPLATE INSTALLATION**

OF PANEL, PRESS JACK


ONCE JACK SHOULDERS COME

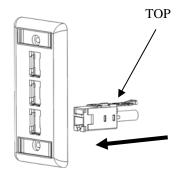


STEP 1: INSERT HD JACK (PULL SLIDE LOCK ALL THE WAY BACK AND ON TOP) FROM REAR SIDE OF FACE PLATE (JACK WILL GO IN ONLY ONE WAY WITH SLIDE LOCK UP.

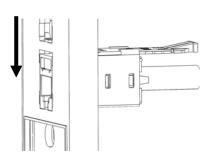


STEP 2: ONCE JACK SHOULDERS COME INTO CONTACT WITH BACKSIDE OF FACE PLATE, PRESS JACK DOWNWARD.

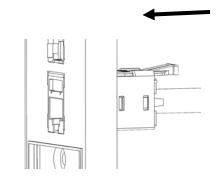

STEP 3: PUSH ON SLIDE LOCK UNTIL THE FRONT IS FLUSH WITH THE JACK **FACE** 

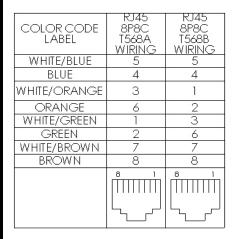

WIRING CHART

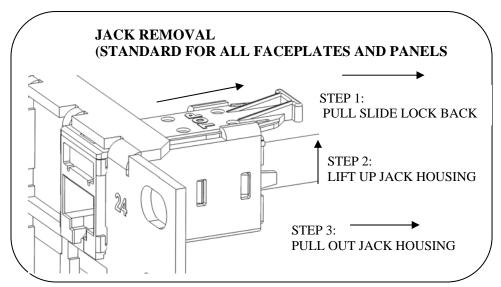

INSTRUCTION SHEET #	REV.	ECN#	SHEET	DWN. BY:	DATE	CHK. BY:	DATE	APP. BY:	DATE
71601781	01	04216	2 OF 2	RWS	08/10/11	G.L.	01/26/12	W. DIETZ	01/26/12